

# Centric Display Installation

## Part 1: Flush Mount Display

### Step 1

Refer to template for cutout dimensions supplied.

### Step 2

Ensure the rubber O-ring is properly seated before installation.

### Step 3

Slide display into cutout.

### Step 4

Use 4 screws for fastening display.

### Step 5

Insert screw covers over screws. Tap gently into place.


Step 2



Step 4



Step 5

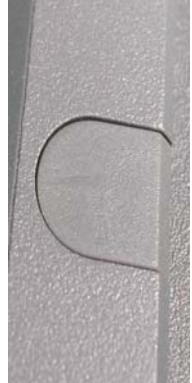

## Part 2: Connecting Cables to the Display

NOTE: Connect all video input cables before connecting the power.

### Step 1

Plug the DVI / VGA connectors into place and tighten screws firmly

### Step 2

Connect Composite and S-Video cables if applicable.

### Step 3

Gently pull on all cables to insure that they are connected securely.



## Part 3: Connecting the Display to 115 / 230 VAC

### Step 1

Ensure the voltage switch on the rear of display is on 115 VAC or 230 VAC as required

### Step 2

Connect the male end into the proper power source. Connect the power cable into the display.



## Part 3: Connecting the Display to 24 VDC

### Step 1

Using 14 gauge wire, connect both +/- ends to the DC power plug. Gently pull on wires to ensure they are connected securely.

### Step 2


Connect opposite end to a regulated 24 VDC power source.

### Step 3

Using a calibrated volt meter, ensure 24 VDC is being supplied to the DC power plug.

### Step 4

Connect power plug to display, tighten fastening screws securely to the display.

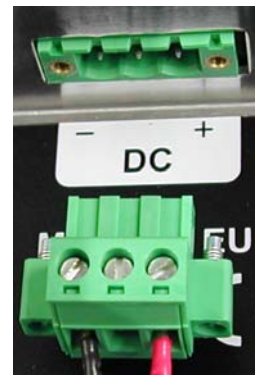

For Technical support contact [support@nauticomp.com](mailto:support@nauticomp.com) tel: 705-328-2992 fax: 705-328-2990