

NVIS Display Installation Guide

Part 1: Flush Mount Display

Step 1

Slide display into cutout

Step 2

Place supplied washers between foam gasket and display. Install machine screw into NVIS Display

Step 4

Tighten machine screws to **12 in/lbs.**

DO NOT OVER TIGHTEN




Part 2: Connecting the Display to Power

Step 1

Connect input voltage wires (1) from vessels power supply (i.e. 12, 24, 36 VDC or 110 VAC as specified on order) to power supply. Connect red wire to positive input terminal and the black wire to negative input terminal. Tighten connectors securely.

Step 2

Connect the cable (2) to the display. Tighten connectors securely.

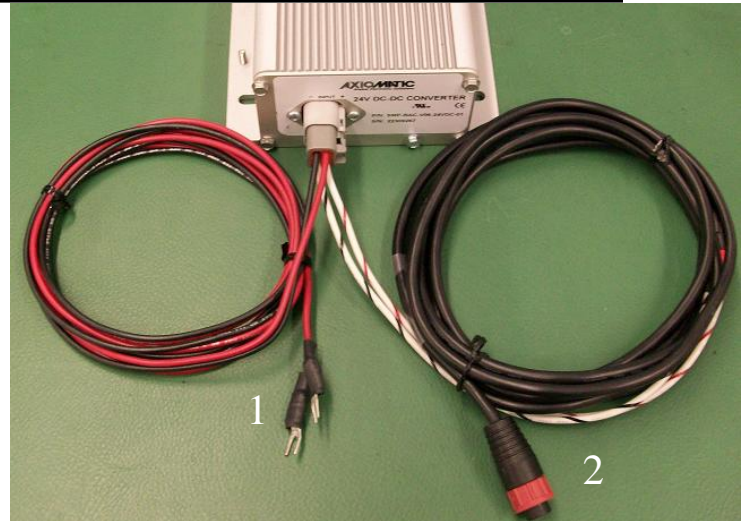

Part 3: Connecting Cables to the Display

POWER OUTPUT FROM THE PROVIDED POWER SUPPLY IS TO BE 24VDC. PLEASE DOUBLE CHECK BEFORE CONNECTING TO THE DISPLAY FOR THE FIRST TIME.

PLEASE NOTE: ALWAYS CONNECT ALL VIDEO INPUT CABLES BEFORE CONNECTING THE POWER

Step 1

Press the connectors into place and tighten screws firm, **DO NOT** over tighten

Step 2

Align LTW logo on connector so that it faces away from the display. Press in and screw connector clockwise until secure, repeat step for all LTW round ended cables.

Step 3

Gently pull all cables to insure that they are connected securely.



For Any assistance with the operation of your new NVIS Display, Please call us @ 705-328-2992

See reverse for Quick Reference Guide